INNOVATIVE

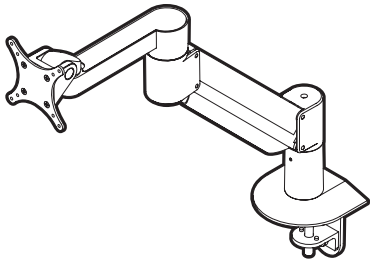

MODEL 7500

Installation Instructions

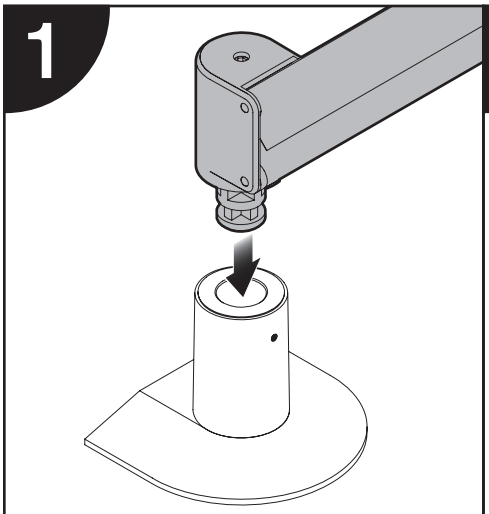

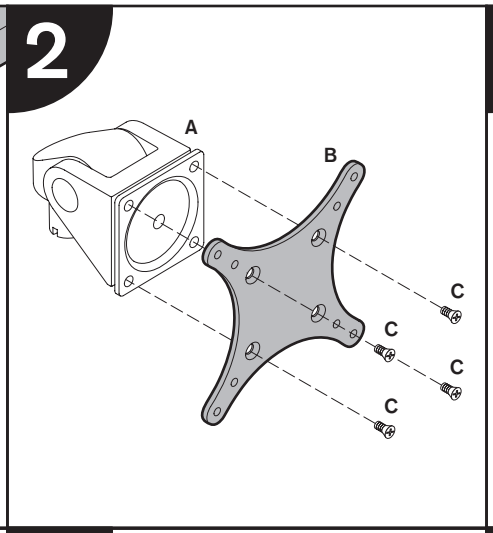

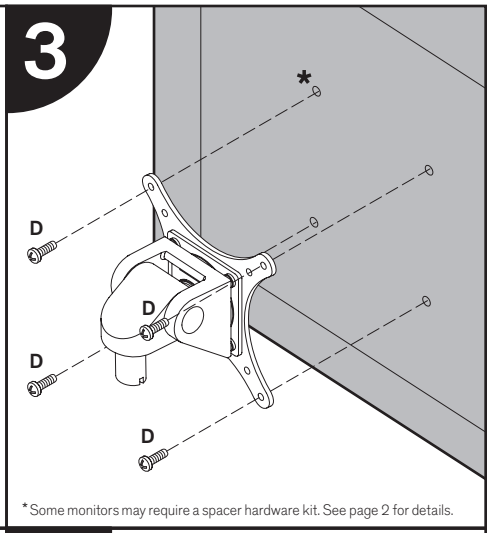

*Some monitors may require a spacer hardware kit. See page 2 for details.

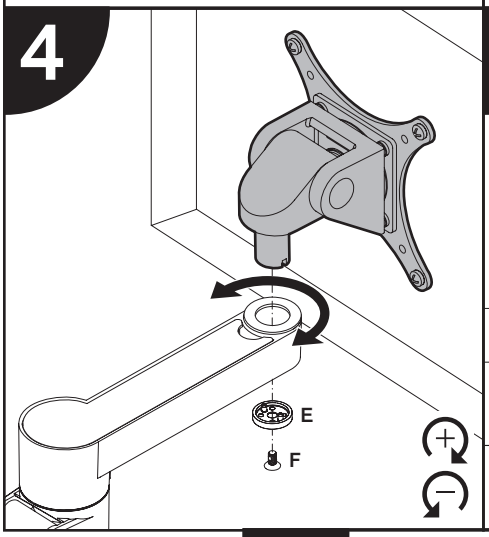

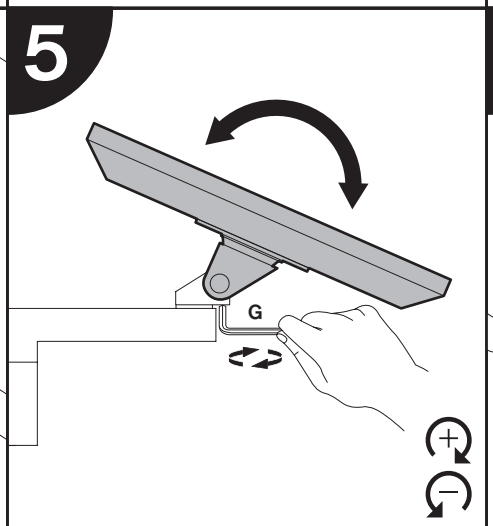

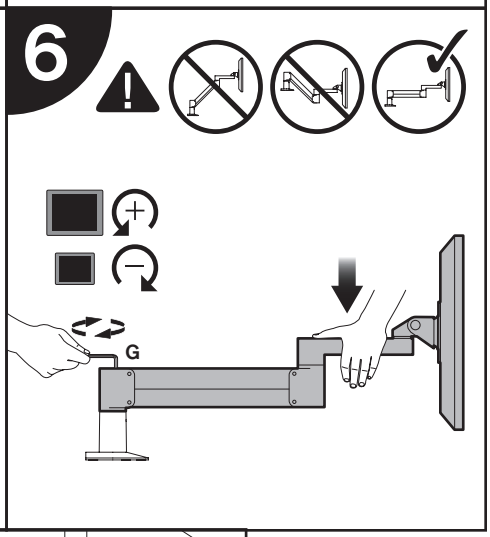

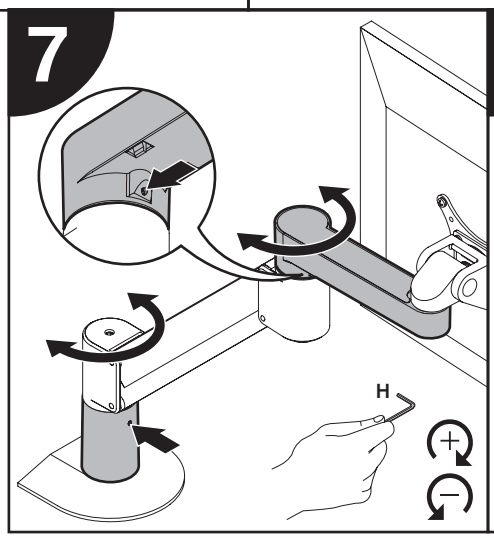

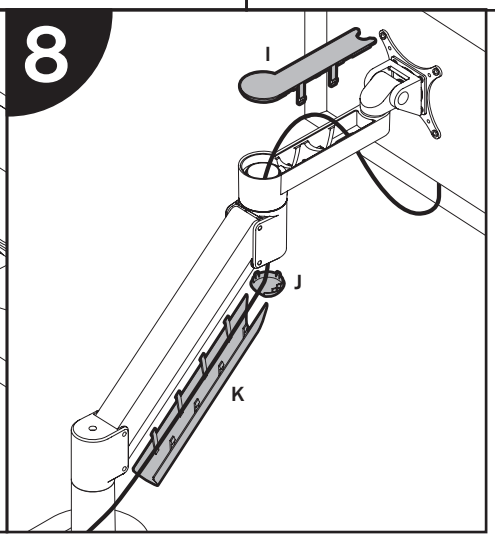

© 2012 Innovative Office Products, Inc.

MODEL 7500
Parts List

ITEM		DESCRIPTION / PART NO.	QUANTITY
A		**Spring-Assisted Monitor Tilter** 407747	1
B		**75/100mm VESA® Adapter Plate** 105587	1
C		**10-32 x 3/8" Phillips Flat Head Screw** 702281 (4-pack)	1
D		**M4 x 12mm Phillips Pan Head Screw** 702096 (4-pack)	1
E		**Dog Washer** 105189	1
F		**10-32 x 3/8" FPhMS w/Lock Patch** 705198	1

ITEM		DESCRIPTION / PART NO.	QUANTITY
G	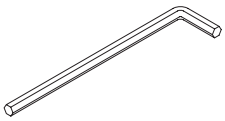	**7/32" Allen Wrench** 701127	1
H		**3/32" Allen Wrench** 700146	1
I	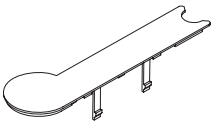	**Forearm Cap** 109597	1
J		**Endcap Bumper** 702829	1
K	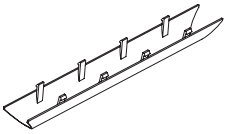	**Cable Cap** 109344	1

OPTIONAL SPACER KITS In some cases, the mounting surface on your monitor may be recessed further than permitted by VESA® standards. As a result, a spacer kit may be required.

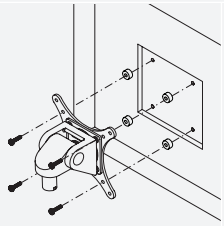

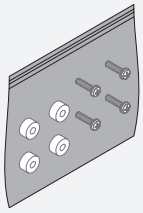

.25" Spacer Hardware Kit
(4) .25" Spacers
(4) M4 x 18mm Phillips Pan Head Screws
Order # P404923-B

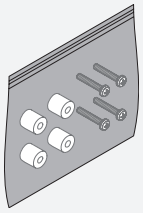

.5" Spacer Hardware Kit
(4) .5" Spacers
(4) M4 x 25mm Phillips Pan Head Screws
Order # P404923-C

This product is protected by one or more of the following U.S. Patent Nos., and other United States and foreign patents applied for: 119,345, 119,346, 1,324,842, 2,470,525, 6,076,785, 6,273,383, 6,409,134, 6,478,274, 6,499,704, 6,505,988, 6,609,691, 619,606, 6,719,253, 6,726,167, 6,736,364, 6,783,105, 6,854,698, 6,915,994, 6,935,883, 6,955,328, 6,983,917, 6,986,489, 7,014,157, 7,017,874, 7,048,242, 7,059,574, 7,063,296, 7,066,433, 7,066,435, 7,389,965, 7,665,699, D435,852, D491,952, D492,893, D570,853, D575,293.

How do I counterbalance my arm?

1

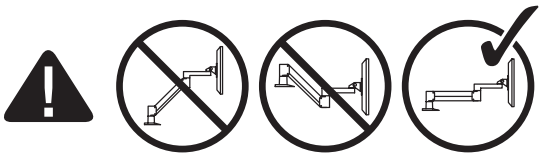

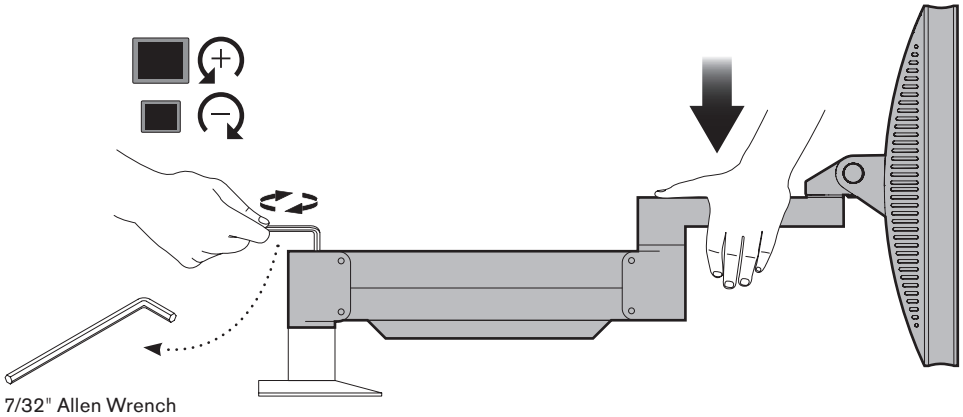

7/32" Allen Wrench

IMPORTANT!
- Monitor must be on arm
- Arm must be in mount

Press the arm down to approximately parallel with the desk prior to turning the strength adjustment screw.



If the arm **drifts upward,** turn the adjustment screw clockwise.



If the arm **drifts downward,** turn the adjustment screw counter-clockwise.

Depending on the weight of your monitor, **you may have to make 15-20 turns.**

2

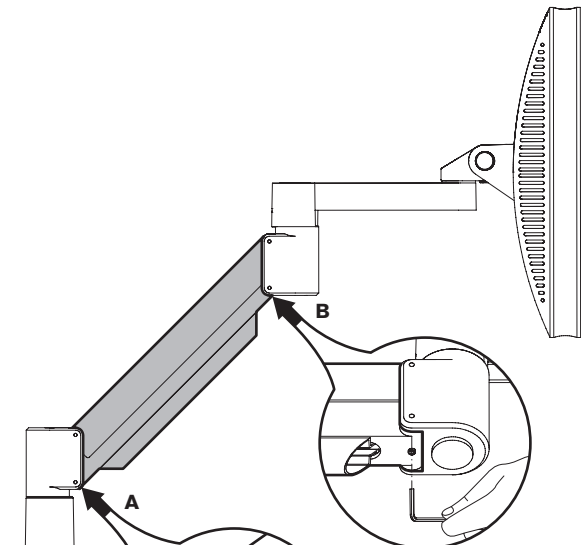

3/32" Allen Wrench

In some instances, further counterbalance adjustments are needed to allow the arm's instant height adjustment function to work properly.

If your arm is not staying in position after performing step 1, follow these steps:

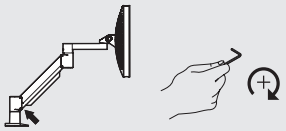

With arm in raised position, tighten set screw **(A).**



With arm in horizontal position, tighten set screw **(B).**

Do not over tighten screws.

FLEXMOUNT™ 8318

Installation Instructions

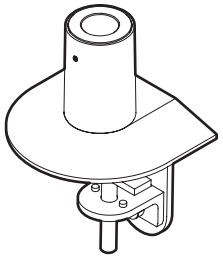

Desk Clamp

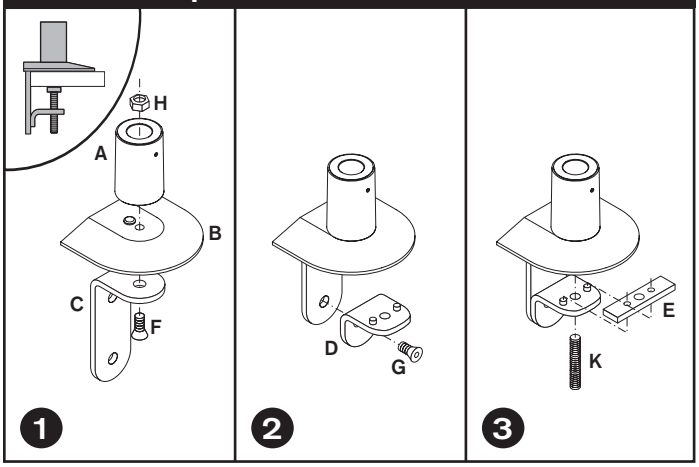

Thru-Desk

8318-cup

8318-thru

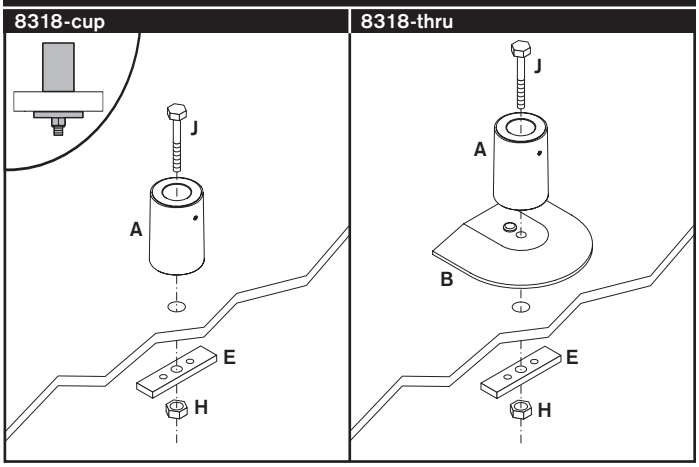

Wall Mount

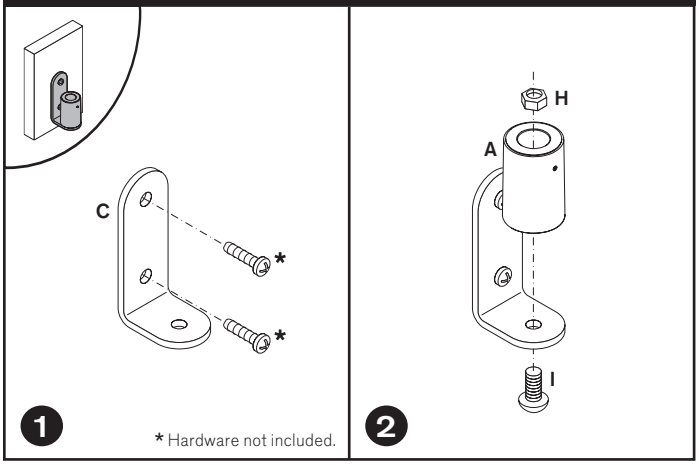

* Hardware not included.

Reverse Wall Mount

8318-wall

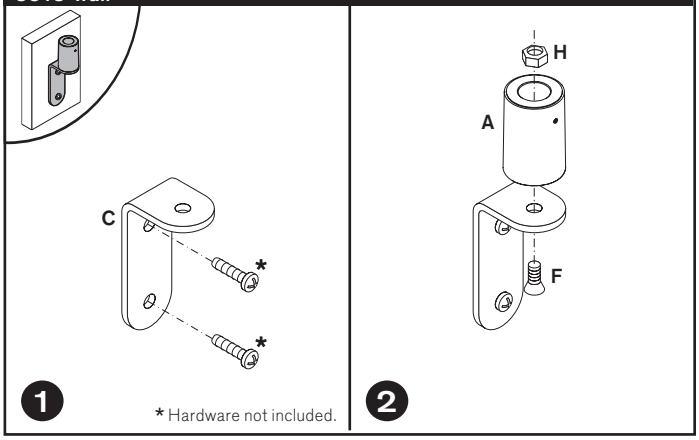

* Hardware not included.

Grommet Hole

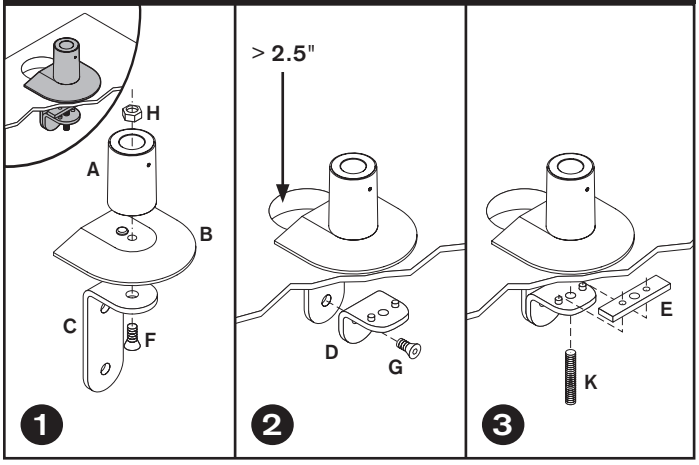

Side Bolt

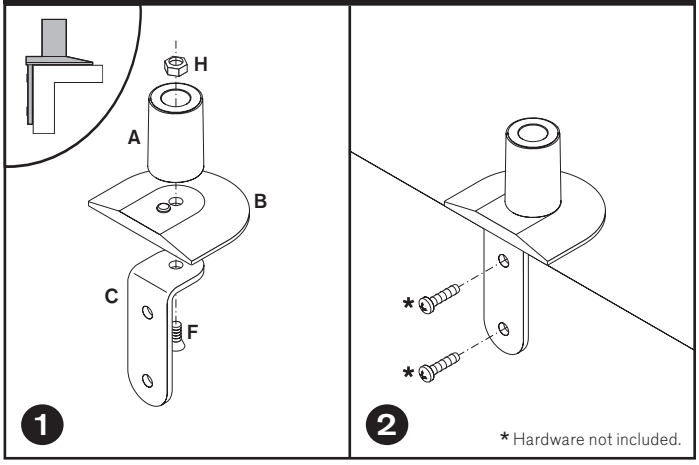

* Hardware not included.

© 2010 Innovative Office Products, Inc.

P506083 REV B

INNOVATIVE

FLEXMOUNT™ 8318

Parts List

ITEM		DESCRIPTION / PART NO.	QUANTITY
A		**Mount Column** 407602	1
B	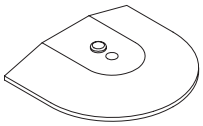	**Base Plate** 754220	1
C	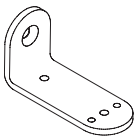	**Large “L” Bracket** 702828	1
D		**Small “L” Bracket** 701116	1
E		**Rectangular Spacer** 701544	1
F		**3/8-16 x 1-1/4" Flat Socket Cap Screw** 701855	1
G		**3/8-16 x 7/8" Flat Socket Cap Screw** 701799	1

ITEM		DESCRIPTION / PART NO.	QUANTITY
H		**3/8-16 Nylon Stop Nut** 701418	1
I		**3/8-16 x 7/8" Button Socket Cap Screw** 701122	1
J	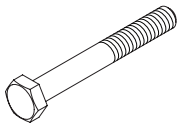	**3/8-16 x 2-1/2" Hex Head Bolt** 700268	1
K	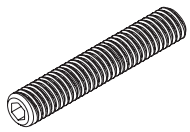	**1/2-13 x 3" Socket Set Screw** 701126	1
L	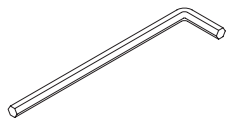	**7/32" Allen Wrench** 701127	1
M		**3/32" Allen Wrench** 700146	1

This product is protected by one or more of the following U.S. Patent Nos., and other United States and foreign patents applied for: 119,345, 119,346, 1,324,842, 2,470,525, 6,076,785, 6,273,383, 6,409,134, 6,478,274, 6,499,704, 6,505,988, 6,609,691, 619,606, 6,719,253, 6,726,167, 6,736,364, 6,783,105, 6,854,698, 6,915,994, 6,935,883, 6,955,328, 6,983,917, 6,986,489, 7,014,157, 7,017,874, 7,048,242, 7,059,574, 7,063,296, 7,066,433, 7,066,435, 7,389,965, 7,665,699, D435,852, D491,952, D492,893, D570,853, D575,293.